



**AGGREGATE PROPERTIES**

REPORT TO: **A&K EARTHMOVERS**  
**1200 AUCTION ROAD**  
**FALLON, NV 89406**  
**(775) 423-6085**

PROJECT: **MATERIAL QA-2006**

LOCATION: **DESERT MOUNTAIN PIT**  
**CHURCHILL COUNTY, NV**

PROJECT NO: **6646.001**

A&K P.O.: **7600**


LAB NO: **1014**

DATE: **10.17.06**

SAMPLED BY: **CLIENT**

SAMPLE DESCRIPTION: **3/4" DRAIN ROCK**

SAMPLE LOCATION: **DESERT MOUNTAIN PIT, CHURCHILL COUNTY, NEVADA**

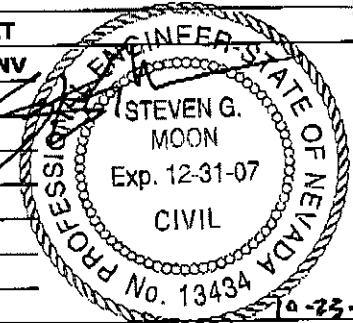

U. S. Std. Sieve Size	Percent Passing	NDOT SEC 704.03.01 TYPE 2
1"	100	100
3/4"	92	90-100
1/2"	58	
3/8"	27	20-55
#4	3	0-10
#10	1.9	
#16	1.8	
#100	1.4	0-4
#200	1.2	0-2

PHYSICAL TEST DATA	RESULTS	SPECIFICATION
ASTM C 131 ABRASION OF COARSE AGGREGATE (LAR)	18%	37% MAXIMUM

**3/4" DRAIN ROCK**

**Fallon Office**   
 178 S. Maine,  
 Fallon, NV 89406  
 Tel. 775.423.2188

**Reno Office**   
 5401 Longley Lane  
 Reno, NV 89511  
 Tel. 775.827.6111

**Tahoe Office**   
 225 Kingsbury Grade  
 Stateline, NV 89449  
 Tel. 775.588.6479

**Carson City Office**   
 800 E. College Parkway  
 Carson City, NV 89706  
 Tel. 775. 883.7077